

WINGERTER LABORATORIES INC.

Engineering Testing & Inspection Services

1820 N.E. 144 St., North Miami, FL 33181

Phone (305) 944-3401 Fax (305) 949-8698

REPORT OF :

CONCRETE LABORATORY TEST REPORT

CLIENT:	Artistic Paver Manufacturing Company	REPORT NO:	1
PROJECT:	Brick Paver Testing	ORDER NO:	01-2014
LOCATION:	WLI @ 1820 N.E. 144th Street, North Miami, FL		
REPORTED TO:	Essig Pools, Incorporated		
	15366 West Dixie Highway - Attn: Mr. Dan Essig, North Miami Beach, FL		
Date Received:	04-23-01	Dated Tested:	04-25-01
Delivered By:	Client	Tested By:	N. Henderson

COMPRESSION TESTING

SAMPLE NO.: 1 - Smooth

Laboratory No.:	19005	19006	19007	19008	19009
Area (Cubic Inches):	16	16	16	16	16
Total Load (lbs.):	145,377	167,724	128,526	141,912	139,370
PSI:	9,086	10,483	8,033	8,870	8,711

Average of Sample # 1 (PSI): 9,036

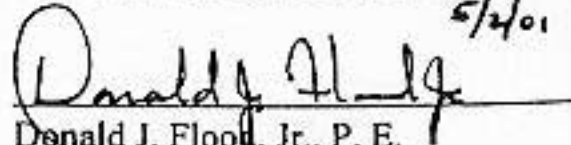
SAMPLE NO.: 2 - Coral

Laboratory No.:	19010	19011	19012	19013	19014
Area (Cubic Inches):	16	16	16	16	16
Total Load (lbs.):	170,281	141,421	135,257	127,067	149,121
PSI:	10,643	8,839	8,454	7,942	9,320

Average of Sample # 2 (PSI): 9,039

REMARKS: Tested in accordance with ASTM C-67.

Respectfully Submitted,
WINGERTER LABORATORIES, INC.


Donald J. Flood, Jr., P. E.
FL Registration No. 44847

The original of this report was signed and sealed by the above Registered Professional Engineer in accordance with Rule 61G15 - 18.011 of Florida Administrative Code. As a mutual protection to clients, the public and ourselves, all reports are submitted as the confidential property of clients and authorization for publication of statements, conclusions or extracts from or regarding our reports is reserved pending our written approval.